

PLL Jitter and its Effects on ECAN™ Technology Communications

Author: Priyabrata Sinha
Microchip Technology Inc.

INTRODUCTION

Phase Locked Loop (PLL) circuits are increasingly used in microcontrollers to achieve higher internal clock frequencies. Incorporation of PLL circuits allows better performance while reducing overall noise. Microchip's dsPIC33F Digital Signal Controllers and PIC24H 16-bit microcontrollers feature programmable PLLs in their clock generation circuits.

One point of interest in the use of PLL circuits is that they create a small, but still measurable, level of transient phase shifts, or *jitter*. This technical brief shows the influence of PLL jitter on CAN communications using the dsPIC33F/PIC24H ECAN module, and explains how the combined effects of jitter and crystal drift are well below the CAN 2.0 specification.


EXTERNAL CRYSTALS, SYSTEM CLOCK AND MEASURABLE JITTER

The clock frequency generated from a PLL circuit is subject to jitter, also defined as Phase Jitter or Phase Skew. This jitter is random in nature, and hence the total error caused by this jitter tends to cancel itself over time. For the dsPIC33F and PIC24H device families, Microchip specifies Clock Jitter (D_{CLK}) as being in the range of -3% to +3%.

Therefore, Total Jitter is $(2 * D_{CLK}) = 6\%$.

The CAN protocol uses a bit stuffing technique that inserts a bit of a given polarity, following five bits with the opposite polarity. This gives a worst-case total of 10 bits transmitted without resynchronization (compensation for jitter or phase error). However, often the Total Jitter per Bit is the parameter of interest. For a single bit, it is necessary to consider only two jitter intervals to correct for jitter induced error: one interval in the beginning of the bit period, and another at the end. The overall effect is shown in Figure 1.

FIGURE 1: EFFECTS OF PHASE JITTER ON THE SYSTEM CLOCK AND CAN BIT TIME

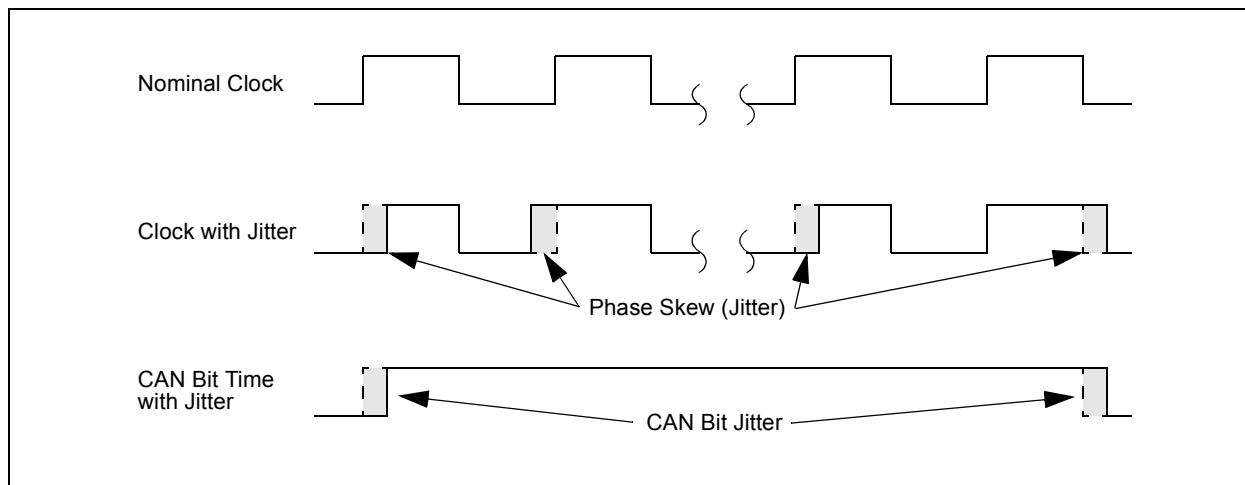

For a single bit, it is possible to show that the relation between the jitter and the total frequency error can be defined as:

EQUATION 1:

$$\Delta f = \frac{\text{Total Jitter}}{\text{NBT}} = \frac{2 \times D_{CLK}}{\text{NBT}}$$

where jitter is expressed in terms of time, and NBT is the Nominal Bit Time.

For example, assume a CAN bit rate of 33.33 kbps, which gives an NBT of 30 μ s. For a 32 MHz clock generated from the PLL, the jitter at this clock frequency is:

EQUATION 2:

$$3\% \times \frac{1}{32 \text{ MHz}} = \frac{0.03}{32 \times 10^6} = 0.9388 \text{ ns}$$

The resultant frequency error is:

EQUATION 3:

$$\frac{2 \times (0.9388 \times 10^{-9})}{30 \times 10^{-6}} = 6.3438 \times 10^{-5} = 0.006\%$$

This is clearly smaller than the expected drift of a crystal oscillator, typically specified at 100 ppm or 0.01%. If we add jitter to oscillator drift, we have a total frequency drift of 0.016%.

Consider another example: assume a CAN bit rate of 83.33 kbps, which gives an NBT of 12 μ s. For a 32 MHz clock generated from the PLL, the jitter at this clock frequency is 0.09388 ns as calculated above. The resultant frequency error is:

EQUATION 4:

$$\frac{2 \times (0.9388 \times 10^{-9})}{12 \times 10^{-6}} = 15.6467 \times 10^{-5} = 0.016\%$$

If we add jitter to oscillator drift, we have a total frequency drift of 0.026%.

Table 1 shows the relation between the clock generated by the PLL and the frequency error from jitter as a percentage of the nominal clock frequency.

The frequency error is directly proportional to the CAN bit rate, and will therefore be even smaller if the CAN bit rate is lower than those listed in Table 1. As expected, the frequency error is inversely proportional to the system clock frequency, which is equivalent to the PLL output if the PLL is enabled.

The total oscillator frequency errors for common clock frequencies and bit rates, including both oscillator drift and jitter per bit, are shown in Table 2.

CONCLUSION

For Microchip's dsPIC33F and PIC24H device families, the sum of the errors introduced by the crystal drift and the errors introduced by the PLL jitter on a per-bit basis is well below the maximum jitter specified by the CAN 2.0 bus specification over a wide range of device clock speeds and CAN bit rates. This makes the usage of the internal PLL in the above device families well-suited for high-speed CAN bus-based communications.

TABLE 1: FREQUENCY ERROR FROM JITTER AT VARIOUS PLL GENERATED CLOCK SPEEDS

| PLL Output | Resultant Device Operating Speed | P_{jitter} | T_{jitter} | Frequency Error at Various Nominal Bit Times (Bit Rates) | | | | | |
|------------|----------------------------------|--------------|--------------|--|----------------------------|-------------------------|-------------------------|-------------------------|-----------------------|
| | | | | 30 μ s (33.33 Kb/s) | 12 μ s (83.33 Kb/s) | 8 μ s (125 Kb/s) | 4 μ s (250 Kb/s) | 2 μ s (500 Kb/s) | 1 μ s (1 Mb/s) |
| 80 MHz | 40 MIPS | 0.375 ns | 0.75 ns | 0.003% | 0.006% | 0.009% | 0.019% | 0.038% | 0.075% |
| 40 MHz | 20 MIPS | 0.75 ns | 1.5 ns | 0.005% | 0.013% | 0.019% | 0.038% | 0.075% | 0.150% |
| 32 MHz | 16 MIPS | 0.9388 ns | 1.88 ns | 0.006% | 0.016% | 0.023% | 0.047% | 0.094% | 0.190% |

TABLE 2: TOTAL FREQUENCY ERROR AT VARIOUS PLL GENERATED CLOCK SPEEDS (100 ppm OSCILLATOR DRIFT INCLUDING ERROR FROM JITTER)

| PLL Output | Resultant Device Operating Speed | Frequency Error at Various Nominal Bit Times (Bit Rates) | | | | | |
|------------|----------------------------------|--|----------------------------|-------------------------|-------------------------|-------------------------|-----------------------|
| | | 30 μ s (33.33 Kb/s) | 12 μ s (83.33 Kb/s) | 8 μ s (125 Kb/s) | 4 μ s (250 Kb/s) | 2 μ s (500 Kb/s) | 1 μ s (1 Mb/s) |
| 80 MHz | 40 MIPS | 0.013% | 0.016% | 0.019% | 0.029% | 0.048% | 0.085% |
| 40 MHz | 20 MIPS | 0.015% | 0.023% | 0.029% | 0.048% | 0.085% | 0.160% |
| 32 MHz | 16 MIPS | 0.016% | 0.026% | 0.033% | 0.057% | 0.104% | 0.200% |

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

Trademarks

The Microchip name and logo, the Microchip logo, Accuron, dsPIC, KEELOQ, KEELOQ logo, microID, MPLAB, PIC, PICmicro, PICSTART, PRO MATE, rPIC and SmartShunt are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AmpLab, FilterLab, Linear Active Thermistor, Migratable Memory, MXDEV, MXLAB, SEEVAL, SmartSensor and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, dsSPEAK, ECAN, ECONOMONITOR, FanSense, FlexROM, fuzzyLAB, In-Circuit Serial Programming, ICSP, ICEPIC, Mindi, MiWi, MPASM, MPLAB Certified logo, MPLIB, MPLINK, PICkit, PICDEM, PICDEM.net, PICLAB, PICtail, PowerCal, PowerInfo, PowerMate, PowerTool, REAL ICE, rLAB, Select Mode, Smart Serial, SmartTel, Total Endurance, UNI/O, WiperLock and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2007, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.



Printed on recycled paper.

QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
== ISO/TS 16949:2002 ==

Microchip received ISO/TS-16949:2002 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.



WORLDWIDE SALES AND SERVICE

AMERICAS

Corporate Office

2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://support.microchip.com>
Web Address:
www.microchip.com

Atlanta

Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Boston

Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago

Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas

Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit

Farmington Hills, MI
Tel: 248-538-2250
Fax: 248-538-2260

Kokomo

Kokomo, IN
Tel: 765-864-8360
Fax: 765-864-8387

Los Angeles

Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608

Santa Clara

Santa Clara, CA
Tel: 408-961-6444
Fax: 408-961-6445

Toronto

Mississauga, Ontario,
Canada
Tel: 905-673-0699
Fax: 905-673-6509

ASIA/PACIFIC

Asia Pacific Office

Suites 3707-14, 37th Floor
Tower 6, The Gateway
Harbour City, Kowloon
Hong Kong
Tel: 852-2401-1200
Fax: 852-2401-3431

Australia - Sydney

Tel: 61-2-9868-6733
Fax: 61-2-9868-6755

China - Beijing

Tel: 86-10-8528-2100
Fax: 86-10-8528-2104

China - Chengdu

Tel: 86-28-8665-5511
Fax: 86-28-8665-7889

China - Fuzhou

Tel: 86-591-8750-3506
Fax: 86-591-8750-3521

China - Hong Kong SAR

Tel: 852-2401-1200
Fax: 852-2401-3431

China - Nanjing

Tel: 86-25-8473-2460
Fax: 86-25-8473-2470

China - Qingdao

Tel: 86-532-8502-7355
Fax: 86-532-8502-7205

China - Shanghai

Tel: 86-21-5407-5533
Fax: 86-21-5407-5066

China - Shenyang

Tel: 86-24-2334-2829
Fax: 86-24-2334-2393

China - Shenzhen

Tel: 86-755-8203-2660
Fax: 86-755-8203-1760

China - Shunde

Tel: 86-757-2839-5507
Fax: 86-757-2839-5571

China - Wuhan

Tel: 86-27-5980-5300
Fax: 86-27-5980-5118

China - Xian

Tel: 86-29-8833-7252
Fax: 86-29-8833-7256

ASIA/PACIFIC

India - Bangalore

Tel: 91-80-4182-8400
Fax: 91-80-4182-8422

India - New Delhi

Tel: 91-11-4160-8631
Fax: 91-11-4160-8632

India - Pune

Tel: 91-20-2566-1512
Fax: 91-20-2566-1513

Japan - Yokohama

Tel: 81-45-471- 6166
Fax: 81-45-471-6122

Korea - Daegu

Tel: 82-53-744-4301
Fax: 82-53-744-4302

Korea - Seoul

Tel: 82-2-554-7200
Fax: 82-2-558-5932 or
82-2-558-5934

Malaysia - Kuala Lumpur

Tel: 60-3-6201-9857
Fax: 60-3-6201-9859

Malaysia - Penang

Tel: 60-4-227-8870
Fax: 60-4-227-4068

Philippines - Manila

Tel: 63-2-634-9065
Fax: 63-2-634-9069

Singapore

Tel: 65-6334-8870
Fax: 65-6334-8850

Taiwan - Hsin Chu

Tel: 886-3-572-9526
Fax: 886-3-572-6459

Taiwan - Kaohsiung

Tel: 886-7-536-4818
Fax: 886-7-536-4803

Taiwan - Taipei

Tel: 886-2-2500-6610
Fax: 886-2-2508-0102

Thailand - Bangkok

Tel: 66-2-694-1351
Fax: 66-2-694-1350

EUROPE

Austria - Wels

Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen

Tel: 45-4450-2828
Fax: 45-4485-2829

France - Paris

Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Munich

Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Italy - Milan

Tel: 39-0331-742611
Fax: 39-0331-466781

Netherlands - Drunen

Tel: 31-416-690399
Fax: 31-416-690340

Spain - Madrid

Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

UK - Wokingham

Tel: 44-118-921-5869
Fax: 44-118-921-5820

10/05/07