



Understanding and Using Supervisory Circuits

SCOPE

This application note discusses what microcontroller supervisory devices are, why they are needed and some factors to consider when choosing one. Supervisory devices is a broad term that encompasses POR (power on reset) devices, BOD (brown-out detect) devices and watchdog timer devices. This application note will cover supervisor devices with POR and BOD functions only.

WHAT DOES A SUPERVISORY CIRCUIT DO?

A supervisory circuit can be used for several different applications, but there are two primary functions that a supervisor provides:

1. During a power up sequence, the device holds a microcontroller in reset until the system power has come up to the correct level and stabilized (the POR function), and
2. reset the controller immediately if the power drops below a nominal value either at power down or during a 'brown-out' condition.

Some supervisor devices also provide things like low battery warning, watchdog timer and other more elaborate functions that are beyond the scope of this application note.

WHY DO I NEED A SUPERVISORY CIRCUIT ANYWAY?

One question system designers may ask themselves is, "Why do I need one of these things anyway?" There are 3 situations that you must consider when answering this question:

3. What would happen to the microcontroller (or other devices in the system) if there was noise on the supply voltage as it powers up?
4. What would happen if there is a glitch on the power supply while the system is running?
5. What does the microcontroller do when the system power is turned off?


If you ponder these questions and have visions of phone calls from angry customers, then you might consider using a supervisor device.

In the Beginning: Power-Up Problems

Most designers working on a prototype system are familiar with putting a reset switch of some kind on the reset pin of the microcontroller. Why? Because they are making both hardware and firmware changes, which sometimes cause the system to malfunction, resulting in the microcontroller no longer behaving in a rational manner. Sometimes it just plain doesn't work. The system designer pushes the reset button a couple of times to determine if the problem goes away. If not, more changes are made and the process continues. The push button provides a means of manually resetting the system. This may work fine for the system development phase, but what do you do to ensure proper system power-up when it goes into production?

Many systems rely on a simple pullup resistor tied to the reset line and their system works fine every time. But what if different components in the system are all powering up as the supply voltage is ramping up and noise is injected onto the supply line? Most microcontrollers have specs that describe power up ramps for proper initialization of the controller. A glitch on the supply line may very well cause the microcontroller (or some other component) to power-up incorrectly and prevent the system from operating as intended. See Figure 1. A supervisor device solves this problem by holding the microcontroller in reset until the power has reached a stable level. Timeout periods vary for different devices but typical values are 150ms - 500ms. When the timeout period is complete, the device will release the reset line and allow the microcontroller to begin execution of its code.

FIGURE 1: POR FUNCTION

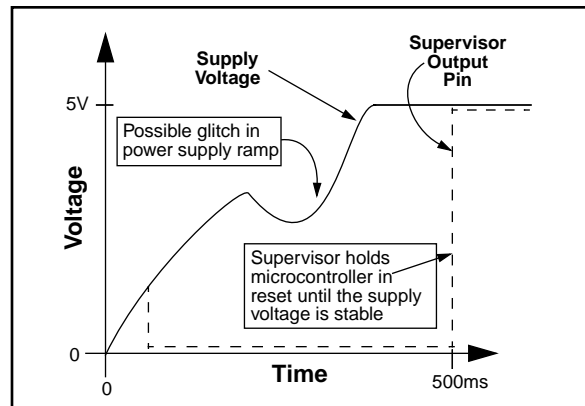


Brown-Out: A Dirty Little Problem

Brown-out (Figure 2) is a condition where the supply voltage dips or 'sags' down to a safe operating level before returning to a nominal level. This condition can be caused by many different things such as inadequate power regulation, system components turning on or off, system malfunctions, etc. Unfortunately, brown-out conditions often don't show up in the system development stage, but wait until the production run begins with all the system components installed to show their ugly heads. It is often at this point that perplexing prob-

lems are discovered, and eventually tracked down to some kind of brown-out condition. These problems can manifest themselves in many different ways including logic levels being misinterpreted or high current situations by creating invalid CMOS input levels. It is also possible to cause a more insidious problem of corrupting RAM locations inside the microcontroller. This problem can lead to irrational behavior on the part of the microcontroller that does different things at different times and may not show itself at all when an emulator is used to track down the problem.

FIGURE 2: BROWN-OUT CONDITION

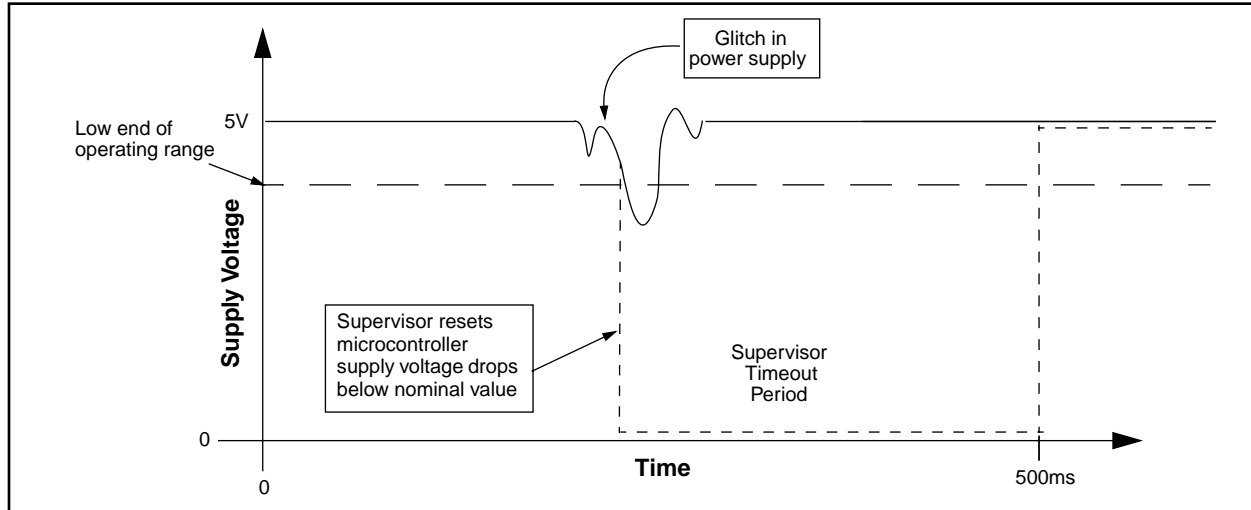


Problems at Power-Down

Most microcontrollers today do not have any on-board POR/BOD protection. Some of them do, but they may not offer adequate protection against some system failures. One system problem that is seen quite frequently is the "Microcontroller running amok" problem that occurs when the supply voltage is ramped down very slowly, such as when a bench power supply is turned down manually or during the decay of a battery supply. When this situation occurs, it is possible for many microcontrollers to begin running through its code in a somewhat random manner. There may not be enough voltage to sustain RAM locations, so the program counter as well as any other variable stored in RAM may not contain valid data. This provides the means for the micro to execute any or all portions of the code stored in program memory with indeterminate values in all RAM locations.

Obviously, the longer it takes for the supply to ramp down the greater the danger of this situation occurring and causing problems. See Figure 3. For some systems, this situation may not cause any problems more serious than some spurious data sent to a display as the system is powered down. However, if the system contains other components that work to a lower voltage such as EEPROM devices, the problem becomes potentially more serious. EEPROM devices are available on the market that work down to 1.8V and may

respond to commands as low as 1.2V. If the microcontroller executes a portion of its code that controls writing to the EEPROM, then there is the distinct possibility that random data will be written to the EEPROM device, which may or may not be discovered when the system is powered up the next time. This problem very often does not show up in the system development phase because the system is not being powered up and down on a regular basis, or it is powered from a supply different from the one used in production. It often shows up when the system goes into production and the system is being tested at different stages of the production line with different power supplies. A typical scenario: Data is written into the EEPROM and the system is tested as good and then powered down. At the next station it is discovered that the EEPROM data has been corrupted. This often results in a call to the EEPROM vendor with complaints of data retention problems, when the actual problem was the microcontroller sending write commands to the EEPROM during power down.

FIGURE 3: MICROCONTROLLER LOSES CONTROL WITH SLOWLY DECAYING SUPPLY

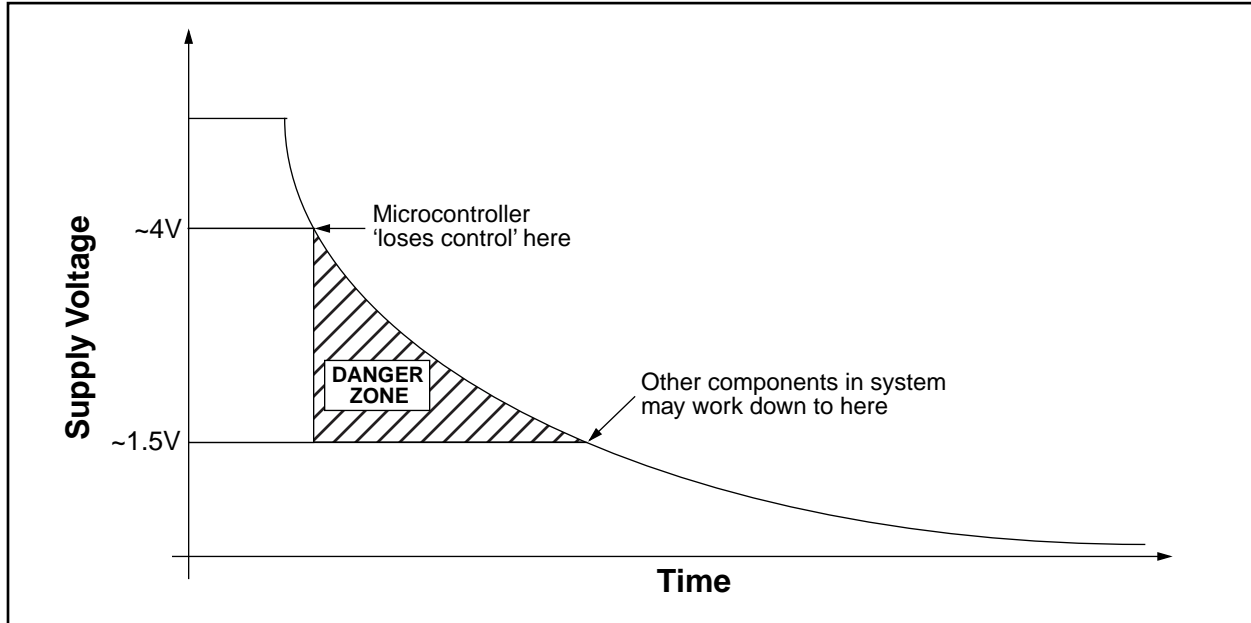

SO HOW DO I CHOOSE THE RIGHT DEVICE?

For the standard POR/BOD type of supervisor device, there are really only a couple of factors that you need to consider when making your choice. The major factors to consider are: reset voltage, output driver type, and reset polarity. Most supervisor devices come in a variety of reset voltages to support both 5V and 3V systems. Table 1, below shows typical reset voltage ranges. Choosing the correct trip point depends mainly on the operating range of the controller you are using and the variation of your supply voltage. You want to choose the highest trip point you can that will not interfere with the normal variations of your supply voltage. For a typical microcontroller, it might operate at 5V \pm 10% or 4.5V - 5.5V. Choosing a device with a trip point range of 4.5V - 4.75V will ensure that the controller is reset before the low end of the operating range is reached.

TABLE 1: TYPICAL TRIP POINT VALUES

Minimum Trip Point (V)	Typical Trip Point (V)	Maximum Trip Point (V)
2.55	2.625	2.7
2.85	2.925	3.0
3.0	3.075	3.15
4.25	4.375	4.50
4.35	4.475	4.60
4.50	4.625	4.75
4.60	4.725	4.85

Many vendors also provide different output driver options for their devices. The usual choices are open drain, open drain with internal pull-up and standard push-pull output drivers. The open drain options allow more than one source to pull the reset line to the reset state, such as a pushbutton or some other component that has the ability to reset the controller such as an over-temperature safety switch.

Since some microcontrollers have a low active reset line and some are high active, you must also choose a reset device with the correct polarity. For reference, the MCP100/120/130 are all active low devices and the MCP101 is active high.

CONCLUSIONS

Using supervisory circuits can protect microcontroller based systems from a number of power-related problems. If you are experiencing problems in your system that are not making sense, it may be power related and if so, it may be beneficial to add a supervisory device to the system. This application note provides some guidelines that you can use in determining what the problem might be and what device should be chosen to solve the problem.

Note the following details of the code protection feature on PICmicro® MCUs.

- The PICmicro family meets the specifications contained in the Microchip Data Sheet.
- Microchip believes that its family of PICmicro microcontrollers is one of the most secure products of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the PICmicro microcontroller in a manner outside the operating specifications contained in the data sheet. The person doing so may be engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable”.
- Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our product.

If you have any further questions about this matter, please contact the local sales office nearest to you.

Information contained in this publication regarding device applications and the like is intended through suggestion only and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. No representation or warranty is given and no liability is assumed by Microchip Technology Incorporated with respect to the accuracy or use of such information, or infringement of patents or other intellectual property rights arising from such use or otherwise. Use of Microchip's products as critical components in life support systems is not authorized except with express written approval by Microchip. No licenses are conveyed, implicitly or otherwise, under any intellectual property rights.

Trademarks

The Microchip name and logo, the Microchip logo, FilterLab, KEELOQ, microID, MPLAB, PIC, PICmicro, PICMASTER, PICSTART, PRO MATE, SEEVAL and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

dsPIC, ECONOMONITOR, FanSense, FlexROM, fuzzyLAB, In-Circuit Serial Programming, ICSP, ICEPIC, microPort, Migratable Memory, MPASM, MPLIB, MPLINK, MPSIM, MXDEV, PICC, PICDEM, PICDEM.net, rPIC, Select Mode and Total Endurance are trademarks of Microchip Technology Incorporated in the U.S.A.

Serialized Quick Turn Programming (SQTP) is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2002, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.



Microchip received QS-9000 quality system certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona in July 1999. The Company's quality system processes and procedures are QS-9000 compliant for its PICmicro® 8-bit MCUs, KEELOQ® code hopping devices, Serial EEPROMs and microperipheral products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001 certified.



MICROCHIP

WORLDWIDE SALES AND SERVICE

AMERICAS

Corporate Office

2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200 Fax: 480-792-7277
Technical Support: 480-792-7627
Web Address: <http://www.microchip.com>

Rocky Mountain

2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7966 Fax: 480-792-7456

Atlanta

500 Sugar Mill Road, Suite 200B
Atlanta, GA 30350
Tel: 770-640-0034 Fax: 770-640-0307

Boston

2 Lan Drive, Suite 120
Westford, MA 01886
Tel: 978-692-3848 Fax: 978-692-3821

Chicago

333 Pierce Road, Suite 180
Itasca, IL 60143
Tel: 630-285-0071 Fax: 630-285-0075

Dallas

4570 Westgrove Drive, Suite 160
Addison, TX 75001
Tel: 972-818-7423 Fax: 972-818-2924

Detroit

Tri-Atria Office Building
32255 Northwestern Highway, Suite 190
Farmington Hills, MI 48334
Tel: 248-538-2250 Fax: 248-538-2260

Kokomo

2767 S. Albright Road
Kokomo, Indiana 46902
Tel: 765-864-8360 Fax: 765-864-8387

Los Angeles

18201 Von Karman, Suite 1090
Irvine, CA 92612
Tel: 949-263-1888 Fax: 949-263-1338

New York

150 Motor Parkway, Suite 202
Hauppauge, NY 11788
Tel: 631-273-5305 Fax: 631-273-5335

San Jose

Microchip Technology Inc.
2107 North First Street, Suite 590
San Jose, CA 95131
Tel: 408-436-7950 Fax: 408-436-7955

Toronto

6285 Northam Drive, Suite 108
Mississauga, Ontario L4V 1X5, Canada
Tel: 905-673-0699 Fax: 905-673-6509

ASIA/PACIFIC

Australia

Microchip Technology Australia Pty Ltd
Suite 22, 41 Rawson Street
Epping 2121, NSW
Australia
Tel: 61-2-9868-6733 Fax: 61-2-9868-6755

China - Beijing

Microchip Technology Consulting (Shanghai)
Co., Ltd., Beijing Liaison Office
Unit 915
Bei Hai Wan Tai Bldg.
No. 6 Chaoyangmen Beidajie
Beijing, 100027, No. China
Tel: 86-10-85282100 Fax: 86-10-85282104

China - Chengdu

Microchip Technology Consulting (Shanghai)
Co., Ltd., Chengdu Liaison Office
Rm. 2401, 24th Floor,
Ming Xing Financial Tower
No. 88 TIDU Street
Chengdu 610016, China
Tel: 86-28-6766200 Fax: 86-28-6766599

China - Fuzhou

Microchip Technology Consulting (Shanghai)
Co., Ltd., Fuzhou Liaison Office
Unit 28F, World Trade Plaza
No. 71 Wusi Road
Fuzhou 350001, China
Tel: 86-591-7503506 Fax: 86-591-7503521

China - Shanghai

Microchip Technology Consulting (Shanghai)
Co., Ltd.
Room 701, Bldg. B
Far East International Plaza
No. 317 Xian Xia Road
Shanghai, 200051
Tel: 86-21-6275-5700 Fax: 86-21-6275-5060

China - Shenzhen

Microchip Technology Consulting (Shanghai)
Co., Ltd., Shenzhen Liaison Office
Rm. 1315, 13/F, Shenzhen Kerry Centre,
Renminnan Lu
Shenzhen 518001, China
Tel: 86-755-2350361 Fax: 86-755-2366086

Hong Kong

Microchip Technology Hongkong Ltd.
Unit 901-6, Tower 2, Metroplaza
223 Hing Fong Road
Kwai Fong, N.T., Hong Kong
Tel: 852-2401-1200 Fax: 852-2401-3431

India

Microchip Technology Inc.
India Liaison Office
Divyasree Chambers
1 Floor, Wing A (A3/A4)
No. 11, O'Shaugnessey Road
Bangalore, 560 025, India
Tel: 91-80-2290061 Fax: 91-80-2290062

Japan

Microchip Technology Japan K.K.
Benex S-1 6F
3-18-20, Shinyokohama
Kohoku-Ku, Yokohama-shi
Kanagawa, 222-0033, Japan
Tel: 81-45-471-6166 Fax: 81-45-471-6122

Korea

Microchip Technology Korea
168-1, Youngbo Bldg. 3 Floor
Samsung-Dong, Kangnam-Ku
Seoul, Korea 135-882
Tel: 82-2-554-7200 Fax: 82-2-558-5934

Singapore

Microchip Technology Singapore Pte Ltd.
200 Middle Road
#07-02 Prime Centre
Singapore, 188980
Tel: 65-334-8870 Fax: 65-334-8850

Taiwan

Microchip Technology Taiwan
11F-3, No. 207
Tung Hua North Road
Taipei, 105, Taiwan
Tel: 886-2-2717-7175 Fax: 886-2-2545-0139

EUROPE

Denmark

Microchip Technology Nordic ApS
Regus Business Centre
Lautrup hof 1-3
Ballerup DK-2750 Denmark
Tel: 45 4420 9895 Fax: 45 4420 9910

France

Microchip Technology SARL
Parc d'Activite du Moulin de Massy
43 Rue du Saule Trapu
Batiment A - 1er Etage
91300 Massy, France
Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79

Germany

Microchip Technology GmbH
Gustav-Heinemann Ring 125
D-81739 Munich, Germany
Tel: 49-89-627-144 0 Fax: 49-89-627-144-44

Italy

Microchip Technology SRL
Centro Direzionale Colleoni
Palazzo Taurus 1 V. Le Colleoni 1
20041 Agrate Brianza
Milan, Italy
Tel: 39-039-65791-1 Fax: 39-039-6899883

United Kingdom

Arizona Microchip Technology Ltd.
505 Eskdale Road
Winnersh Triangle
Wokingham
Berkshire, England RG41 5TU
Tel: 44 118 921 5869 Fax: 44-118 921-5820

01/18/02